



Centre Anti-Poison pour le Québec: (800) 463-5060

Tél. (Qc): (418) 660-8666 / 800-890-8666

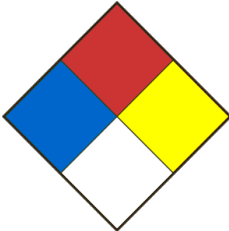
Fax. (Qc): (418) 660-8998

SAFETY DATA SHEET

SECTION 01 - PRODUCT AND COMPANY IDENTIFICATION

Product Identifier Chloramine T•3H ₂ O, Sol. 15%w/v (saturated solution)		Product Use Laboratory use	
Chemical formula C ₇ H ₇ CINNaO ₂ S•3H ₂ O		Product code CS-1515	Molar weight 227,65
Chemical name / Commercial name / Synonymous N-Chloro-p-toluenesulfonamide, sodium salt; Tosylchloramide sodium			
Supplier's name Laboratoire MAT		Address-Street 610, Adanac Street	
City Québec		Province Québec	
Postal code G1C 7B7	Internet www.labmat.com	Phone number 418-660-8666 / 800-890-8666	
Emergency phone	CANUTEC: 613-996-6666 CENTRE ANTI-POISON DU QUÉBEC 800-463-5060		
Date SDS 7/27/2023	SDS Prepared by Laboratoire MAT	E-Mail labmat@labmat.com	

SECTION 02 - HAZARDS IDENTIFICATION

Classification WHIMS / GHS	Serious eye damage/eye irritation - Serious eye damage category 1 Specific Target Organ Toxicity - Repeated exposure category 1 Skin corrosion/irritation - Skin corrosion category 1	
Signal Word	DANGER	
Hazards statements (H)	H314 Causes severe skin burns and eye damage. H318 Causes serious eye damage. H372 Causes damage to organs through prolonged or repeated exposure.	
Precautionary statements (P)	P260 Do not breathe dust / fume / gas / mist / vapors / spray. P264 Wash the areas of the body that have been in contact with the product after handling. P270 Do not eat, drink or smoke when using this product. P280 Wear protective gloves/protective clothing/eye protection/face protection. P301 + P330 + P331 IF SWALLOWED: rinse mouth. Do NOT induce vomiting. P303 + P361 + P353 IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower. P304 + P340 IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing. P305 + P351 + P338 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. P310 Immediately call a POISON CENTER or doctor/physician. P314 Get medical advice/attention if you feel unwell. P321 Specific treatment (see section 4 of the SDS and on this label). P363 Wash contaminated clothing before reuse. P405 Store locked up. P501 Dispose of contents/container in accordance with local / regional / national / international regulations or contact a specialist waste disposal company.	
PICTOGRAMS		
Other dangers	NFPA (Risk: 0=No risk; 1=Slight; 2=Moderate; 3=Signifiant; 4=Extreme)	
	Health 1 Fire 0 Reactivity 0 Special danger	

SECTION 03 - COMPOSITION/INFORMATION ON INGREDIENTS

Ingrédients (Dénomination chimique / synonymes)	Numéro CAS et tout identificateur unique	Concentration (%)
Chloramine T trihydrate	7080-50-4	13

SECTION 04 - FIRST AID MEASURES

Eye contact	Wash eyes with large amounts of water for at least 15 minutes while holding eyelids apart to rinse eyes. If irritation persists, seek medical attention.
Skin contact	Wash skin with plenty of water for at least 15 minutes. Remove soiled clothing. If irritation persists, seek medical attention.
Inhalation	If breathing is difficult, give oxygen. If breathed in, move person into fresh air. If not breathing, give artificial respiration. Consult a physician.
Ingestion	If the person is conscious, give water to drink. Do NOT induce vomiting. Never give anything by mouth to an unconscious person. Consult a physician.
Most important symptoms and effects (acute and delayed)	Main symptoms of high exposure: Nausea and vomiting. Headaches. Asthma. Cyanosis (blue to black coloring of the skin and nails). May cause methemoglobinemia, which results in a generalized slate gray color of the skin. Effects may be delayed. Ref. section 11.
Immediate medical attention and special treatment, if necessary	In case of medical consultation, keep this sheet available.
General advice	Show this safety data sheet to the doctor in attendance.

SECTION 05 - FIREFIGHTING MEASURES

Flammability	No
Ignition conditions	Heat, sparks and open flame.
Suitable extinguishing media	Dry powder.
Unsuitable extinguishing media	Do not use a jet of water.
Hazardous combustion products	Hazardous combustion products formed under fire conditions: Carbon monoxide, carbon dioxide. Chlorine gas. - Hydrogen chloride gas, Sodium oxides. - nitrogen oxides (NOx). - Sulphur oxides
Special fire and explosion hazards	May react violently with incompatible products (Ref Section 10).
Special protective equipment and precautions for firefighters	Discard incompatible substances if this can be done without risk. Firefighters should be equipped with standard protective equipment, fireproof clothing, face mask, gloves, protective boots and, where appropriate, self-contained breathing apparatus.

SECTION 06 - ACCIDENTAL RELEASE MEASURES

Methods and materials for containment and cleaning up / Personal precautions, protective equipment	Evacuate personnel to safe areas. Avoid dust formation. Ensure adequate ventilation. Use personal protective equipment. Use a respirator as needed. Pick up with a shovel or broom, taking care not to scatter dust. Clean and rinse with water. Dispose of residues in a container provided for the disposal of hazardous materials. Do not let product enter drains.
---	--

SECTION 07 - HANDLING AND STORAGE

Conditions for safe storage	Store in a cool, dry place. Keep container tightly closed and store away from heat, water, moisture, and incompatible products.
Methods of handling	Avoid ingestion and inhalation. Avoid contact with the skin, eyes and clothes. Avoid dust formation. Wear personal protective equipment when handling. Always ensure good ventilation. Transport according to TDG (ref Section 14)

SECTION 08 - EXPOSURE CONTROLS/PERSONAL PROTECTION

Workplace control parameters

Components	CAS-No.	Control	Value	Basis
CHLORAMINE-T (TRIHYDRATE)	7080-50-4	TLV, TWA, STEL	No data available	Canada. Alberta, Occupational Health and Safety Code (table 2: OEL)
		TLV, TWA, STEL	No data available	Canada. British Columbia OEL
		TLV, TWA, STEL	No data available	Québec. Regulation respecting occupational health and safety, Schedule 1, Part 1: Permissible exposure values for airborne contaminants

Ventilation	Use fan.
Respiratory	If work under the hood is not possible, or if the permissible levels are exceeded, use a mechanical filter / cartridge against NIOSH vapors or a respirator with air supply.
Gloves	Handle with gloves.
Eyes	Safety goggles with safety shutters.
Shoes	Safety shoes.
Clothing	Labcoat. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace.
Engineering control	Have safety showers and eyewash stations in the workplace in case of an emergency and a ventilation system to maintain the level of concentrations in the air below the exposure limit values.

SECTION 09 - PHYSICAL AND CHEMICAL PROPERTIES

Physical state	Liquid.
Appearance	
Odour	Donnée non disponible.
Odour threshold	Data not available
pH	8.0 - 10.0 à 50 g/l à 20 °C.
Melting point / Freezing point	Data not available
Initial boiling point	Data not available
Boiling range	Data not available
Flash point	Data not available
Evaporation rate	Data not available
Flammability	No
Lower flammable / Explosive limit	Data not available
Upper flammable / Explosive limit	Data not available
Vapour pressure	Data not available
Solubility	Soluble dans l'eau 90.2 - 128 g/L @ 20 °C.
Vapour density	Data not available
Relative density	Data not available
Partition coefficient water/n-octanol	Data not available
Auto-ignition temperature	Data not available
Decomposition temperature	Data not available
Viscosity	Data not available

SECTION 10 - STABILITY AND REACTIVITY

Reactivity	May react violently with incompatible substances.
Chemical stability	Stable under recommended storage conditions. Air sensitive.
Possibility of hazardous reactions	Contact with acids liberates very toxic gas. Avoid dust formation.
Conditions of instability (Including sensitivity to shock / static discharge / vibration)	Avoid contact with incompatible materials. Exposure to moisture.
Incompatible material	Strong oxidants. Acids. Ammoniac.
Hazardous decomposition products	Hazardous decomposition products formed under fire conditions. - Carbon oxides, Nitrogen oxides (NO _x), Sulphur oxides, Hydrogen chloride gas Gaseous chlorine. - Sodium oxides.

SECTION 11 - TOXICOLOGICAL INFORMATION

CHLORAMINE-T (TRIHYDRATE)

Routes of exposure	Ingestion, inhalation, skin and eyes.
Acute exposition effects / symptoms:	By exposure route below.
- Eyes	Causes eye burns.
- Skin	May be harmful if absorbed through skin. Causes skin burns.
- Inhalation	May be harmful if inhaled. The product is extremely destructive to the tissue of the mucous membranes and upper respiratory tract. Headache. Nausea and vomiting. Inhalation effects may be delayed. Respiratory sensitizer.
Acute toxicity (Ingestion)	Toxic if swallowed.
Chronic exposure effects / symptoms	Absorption in the body leads to the formation of methemoglobin which in insufficient concentration causes cyanosis. It can appear after 2 to 4 hours or more. Cough, respiratory failure, migraine, nausea, vomiting. Repeated exposure may cause asthma. Suspected of being a respiratory sensitizer.
DL50 (specify species and route of entry)	Data based on the anhydrous product: LD50 Oral - Rat - 935 mg/kg. LD50 Dermal: Data not available.
CL50 (specify species and route of entry)	Data based on the anhydrous product: LC50 Inhalation - Rat - 4h - 4.15 - 275 mg/m ³ air.

SUMMARY

Acute exposure effects / Symptoms:	By exposure routes below.
Ingestion	To our knowledge, the product has not been fully evaluated
Inhalation	To our knowledge, the product has not been fully evaluated
Skin	To our knowledge, the product has not been fully evaluated
Eyes	To our knowledge, the product has not been fully evaluated
Chronic exposure effects / Symptoms:	To our knowledge, the product has not been fully evaluated
ETA Mix (Estimated Acute Toxicity)	LD50 Oral: 8847 mg/kg - Rat LD50 Dermal: > 5000 mg/kg - Rat - Rabbit - No data available -- Undefined species LC50 Inhalation: 32-2108mg/m ³ - 4h - Rat

SECTION 12 - ECOLOGICAL INFORMATION

Available ecological information	No
---	----

SECTION 13 - DISPOSAL CONSIDERATIONS

Waste Disposal Method	Dispose of contents / container in accordance with local / regional / national / international regulations / or contact a specialist waste disposal company.
Contaminated Packaging	Dispose of as unused product.

SECTION 14 - TRANSPORT INFORMATION

UN Number	N/R
UN Proper shipping name	
Transport hazard class(es)	
Packing group	
Limited quantity index	
ERAP Index	
Special precautions	

SECTION 15 - REGULATORY INFORMATION

WHIMS CANADA	Serious eye damage/eye irritation - Serious eye damage category 1 Specific Target Organ Toxicity - Repeated exposure category 1 Skin corrosion/irritation - Skin corrosion category 1
--------------	---

SECTION 16 - OTHER INFORMATION

Further information

The information in this document is based on the present state of our knowledge and is applicable to the product with regard to appropriate safety precautions. The above information is believed to be correct but does not purport to be all inclusive and shall be used only as a guide. It does not represent any guarantee of the properties of the product. Laboratoire MAT Inc. shall not be held liable for any damage resulting from handling or from contact with the above product.

Last Update: 7/27/2023