



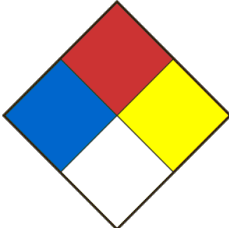
Centre Anti-Poison pour le Québec: (800) 463-5060
Tél. (Qc): (418) 660-8666 / 800-890-8666
Fax. (Qc): (418) 660-8998

SAFETY DATA SHEET

SECTION 01 - PRODUCT AND COMPANY IDENTIFICATION

Product Identifier POTASSIUM IODATE 0.01N		Product Use Laboratory use	
Chemical formula KIO ₃		Product code PS-0118	Molar weight 214
Chemical name / Commercial name / Synonyms POTASSIUM IODATE, IODIC ACID POTASSIUM SALT, ODIC ACID (HIO ₃), POTASSIUM SALT, POTASSIUM IODINE OXIDE,			
Supplier's name Laboratoire MAT		Address-Street 610, Adanac Street	
City Québec		Province Québec	
Postal code G1C 7B7	Internet www.labmat.com	Phone number 418-660-8666 / 800-890-8666	
Emergency phone	CANUTEC: 613-996-6666	CENTRE ANTI-POISON DU QUÉBEC 800-463-5060	
Date SDS 7/10/2023	SDS Prepared by Laboratoire MAT	E-Mail labmat@labmat.com	

SECTION 02 - HAZARDS IDENTIFICATION

Classification WHIMS / GHS	Not a hazardous substance according to WHMIS 2015
Other dangers	NFPA (Risk: 0=No risk; 1=Slight; 2=Moderate; 3=Signifiant; 4=Extreme)
	Health 1 Fire 0 Reactivity 0 Special danger

SECTION 03 - COMPOSITION/INFORMATION ON INGREDIENTS

Ingrédients (Dénomination chimique / synonymes)	Numéro CAS et tout identificateur unique	Concentration (%)
Iodate de potassium	7758-05-6	0.04

SECTION 04 - FIRST AID MEASURES

Eye contact	Wash eyes with large amounts of water for at least 15 minutes while holding eyelids apart to rinse eyes. If irritation persists, seek medical attention.
Skin contact	Wash skin with plenty of water for at least 15 minutes. Remove soiled clothing. If irritation persists, seek medical attention.
Inhalation	Move the unwell person to the fresh air. If breathing is difficult, give oxygen. Consult a physician.
Ingestion	If the person is conscious, drink water and do not induce vomiting. Never give anything by mouth to an unconscious person. Consult a physician.
Most important symptoms and effects (acute and delayed)	Main symptoms of high exposure: Skin, eye and respiratory system irritation. Vomiting. Liver damage. Kidney damage. Convulsions. Ref. section 11.
Immediate medical attention and special treatment, if necessary	In case of medical consultation, keep this sheet available.
General advice	Show this safety data sheet to the doctor in attendance.

SECTION 05 - FIREFIGHTING MEASURES

Flammability	No
Ignition conditions	Not flammable or combustible. Risk of fire or explosion if heated or crushed in presence of combustible products.
Suitable extinguishing media	Use water spray, alcohol-resistant foam, dry chemical or carbon dioxide.
Unsuitable extinguishing media	Data not available.
Hazardous combustion products	Hazardous combustion products formed under fire conditions: - Hydrogen iodide, Potassium oxides
Special fire and explosion hazards	When concentrated, the product reacts according to the following characteristics: Oxidizer. In the event of a fire, the water in the solution will evaporate, and the oxidizing base product will fuel the fire. Compounds composed of cyanides, manganese dioxide, hydrides of metals, fine particles of metals (aluminum, arsenic, carbon, copper, sulfur), phosphorus, sulphides and potassium thiocyanates, the products of which are heated, moistened or combined with sulfuric acid. May react violently with incompatible products (Ref Section 10).
Special protective equipment and precautions for firefighters	Discard incompatible substances if this can be done without risk. Firefighters should be equipped with standard protective equipment, fireproof clothing, face mask, gloves, protective boots and, where appropriate, self-contained breathing apparatus.

SECTION 06 - ACCIDENTAL RELEASE MEASURES

Methods and materials for containment and cleaning up / Personal precautions, protective equipment	Evacuate personnel to safe areas. Absorb the product with sand or vermiculite. Dilute residues with water, clean and rinse. Ensure a good ventilation of the premises. Dispose of residues in a container for disposal of hazardous materials. When handling, wear suitable safety equipment. Use breathing apparatus if necessary. Do not let product enter drains.
---	--

SECTION 07 - HANDLING AND STORAGE

Conditions for safe storage	Store in a cool, dry place. Store in a well-ventilated area. Keep container tightly closed and store away from heat, moisture, combustible and incompatible products.
Methods of handling	Always open containers slowly to allow any excess pressure to vent. Avoid ingestion and inhalation. Keep away from clothes and other combustible materials. Avoid formation of dust and aerosols. Avoid shock and friction. Keep away from heat and sources of ignition. Provide appropriate exhaust ventilation at places where dust or vapor is formed. Keep away from sources of ignition - No smoking. Normal measures for preventive fire protection. Wear personal protective equipment when handling. Always ensure good ventilation. Transport according to TDG (ref Section 14)

SECTION 08 - EXPOSURE CONTROLS/PERSONAL PROTECTION

Workplace control parameters

Components	CAS-No.	Control	Value	Basis
POTASSIUM IODATE	7758-05-6	TLV, TWA, STEL	No data available	Canada. Alberta, Occupational Health and Safety Code (table 2: OEL)
		TLV, TWA, STEL	No data available	Canada. British Columbia OEL
		TLV, TWA, STEL	No data available	Québec. Regulation respecting occupational health and safety, Schedule 1, Part 1: Permissible exposure values for airborne contaminants

Ventilation	Use fan.
Respiratory	If the permissible levels are exceeded, use a mechanical filter / cartridge against NIOSH vapors or a respirator with air supply.
Gloves	Handle with gloves.
Eyes	Safety goggles with safety shutters.
Shoes	Safety shoes.
Clothing	Labcoat. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace.
Engineering control	Have safety showers and eyewash stations in the workplace in case of an emergency and a ventilation system to maintain the level of concentrations in the air below the exposure limit values.

SECTION 09 - PHYSICAL AND CHEMICAL PROPERTIES

Physical state	Liquid.
Appearance	Liquide clair.
Odour	inodore.
Odour threshold	Data not available
pH	Solution aqueuse 5% = pH 5.0 - 8.0.
Melting point / Freezing point	Data not available
Initial boiling point	Data not available
Boiling range	Data not available
Flash point	Data not available
Evaporation rate	Data not available
Flammability	No
Lower flammable / Explosive limit	Data not available
Upper flammable / Explosive limit	Data not available
Vapour pressure	Data not available
Solubility	Soluble dans l'eau (8%). Insoluble dans l'alcool.
Vapour density	Data not available
Relative density	Data not available
Partition coefficient water/n-octanol	Data not available
Auto-ignition temperature	Data not available
Decomposition temperature	Data not available
Viscosity	Data not available

SECTION 10 - STABILITY AND REACTIVITY

Reactivity	Oxidizer: risk of fire in case of contact with combustible / organic substance.
Chemical stability	Stable under recommended storage conditions. Oxidizer: Fire hazard in case of contact with combustible / organic substance.
Possibility of hazardous reactions	Risk of fire or explosion if heated or crushed in presence of combustible or organic products.
Conditions of instability (Including sensitivity to shock / static discharge / vibration)	Avoid excessive heat. Reacts with combustible materials. Avoid contact with incompatible materials.
Incompatible material	When pure, the product reacts with the following products: Strong reducing agents, Metal powders, Incompatibility: iodate mixtures with aluminum, arsenic, copper, carbon, phosphorus sulphide (red and white) finely divided; hydrides of alkali and alkaline earth metals; sulfides of antimony, arsenic, copper or tin, metal cyanides, thiocyanates or impure manganese dioxide may react violently or explosively, either spontaneously (especially in the presence of moisture), or triggered by heat, friction, shock, sparks or addition of sulfuric acid. Organic materials, Strong oxidizing agents, Sulphides, Peroxides, Metals, Agents Reducing agents, Strong reducing agents, Combustible material.
Hazardous decomposition products	Hazardous decomposition products formed under fire conditions. - Hydrogen iodide, Potassium oxides

SECTION 11 - TOXICOLOGICAL INFORMATION

POTASSIUM IODATE

Routes of exposure	Ingestion, inhalation, skin and eyes.
Acute exposition effects / symptoms:	By exposure route below.
- Eyes	Irritation and tearing.
- Skin	Irritation and dermatitis.
- Inhalation	Irritation of the mucous membranes and respiratory tract. Nervous disorders, cough, dyspnea, headache, dizziness, nausea and vomiting.
Acute toxicity (Ingestion)	Irritation of the mucous membranes. Gastrointestinal disorders, cramps, diarrhea, headache, dizziness, sweating, salivation, convulsions, nausea and vomiting.
Chronic exposure effects / symptoms	Burning sensation, dermatitis, nervous disorders, chest pain, cough, dyspnea, headache, dizziness, confusion, irritability, tearing, tiredness, nausea and vomiting.
DL50 (specify species and route of entry)	LD50 Oral - Mouse - 531 mg / kg LD50 Oral - guinea pig - 400 mg / kg LD50 Dermal - Rat - 2000mg/kg.
CL50 (specify species and route of entry)	LC50 - Inhalation - Data not available.

SUMMARY

Acute exposure effects / Symptoms:	By exposure routes below.
Ingestion	To our knowledge, the product has not been fully evaluated
Inhalation	To our knowledge, the product has not been fully evaluated
Skin	To our knowledge, the product has not been fully evaluated
Eyes	To our knowledge, the product has not been fully evaluated
Chronic exposure effects / Symptoms:	To our knowledge, the product has not been fully evaluated
ETA Mix (Estimated Acute Toxicity)	LD50 Oral: > 5000 mg/kg - Rat LD50 Dermal: No data available LC50 Inhalation: No data available

SECTION 12 - ECOLOGICAL INFORMATION

Ecotoxicity	Data not available.
Persistence and degradability	Soluble in water. Persistence is unlikely based on the information provided.
Bioaccumulative potential	Data not available.
Mobility in soil	Probable mobility in the environment due to its solubility in water.
Other adverse effects	Avoid release to the environment. Do not throw residues in the sewer.

SECTION 13 - DISPOSAL CONSIDERATIONS

Waste Disposal Method	Dispose of contents / container in accordance with local / regional / national / international regulations / or contact a specialist waste disposal company.
Contaminated Packaging	Dispose of as unused product.

SECTION 14 - TRANSPORT INFORMATION

UN Number	N/R
UN Proper shipping name	
Transport hazard class(es)	
Packing group	
Limited quantity index	
ERAP Index	
Special precautions	

SECTION 15 - REGULATORY INFORMATION

WHIMS CANADA	Not a hazardous substance according to WHMIS 2015
--------------	---

SECTION 16 - OTHER INFORMATION

Further information

The information in this document is based on the present state of our knowledge and is applicable to the product with regard to appropriate safety precautions. The above information is believed to be correct but does not purport to be all inclusive and shall be used only as a guide. It does not represent any guarantee of the properties of the product. Laboratoire MAT Inc. shall not be held liable for any damage resulting from handling or from contact with the above product.

Last Update: 7/10/2023